

STANDARD

Test & Measuring Instruments

ANALOG INSULATION TESTER (1kV below)



1832 IN

FEATURES

- High quality Taut Band movement.
- Three insulation test voltage (DC): 250V, 500V, 1000V.
- Two continuity test on low ohms: 500Ω & 3Ω .
- Small and lightweight, all in one case (do not need bag).
- AC voltmeter with linear scale up to 600 Vac.
- 200mA continuity short circuit current.
- 1mA test current on insulation test at nominal voltage.
- Automatic discharge of capacitance and inductive circuit off charge stored in the circuit under test.
- Live warning and display of external voltage presence.
- Fuse, air gap, crowbar and overload protected.
- On line battery monitoring shows if battery is ok.
- Very low battery consumption.
- On-Load battery check (+/- 205mA load for worst case).
- Mirror scale.
- Push and turn locking switch for long and hand free testing.
- IEC 1010-1 CAT III 600V
- BS 16th edition.

SPECIFICATIONS

Insulation Resistance

Test Voltage (DC V)	250V	500V	1000V
Output Voltage on open circuit	Rated test Voltage +10%		
Measuring Ranges	0-100ΜΩ	0 - 200 M Ω	0 -400M Ω
Mid-Scale Valve	1ΜΩ	$2M\Omega$	$4M\Omega$
Scale Multiplier	×1/2	×1	×2
Accuracy	±3% of indicated valve		
Output Short-Circuit Current	1.3mA		

Continuity

Measuring Ranges	3Ω/500Ω
Output Short-Circuit Current	≥210mA
Accuracy	±1.5% of scale length

AC Voltage


AC Voltage Range	0-600V AC
Accuracy	±3% of scale length

General

Voltage Warning	Warning light circuit live lit	
	From 90Vdc/70Vac	
	Buzzer beep from 24Vac/dc	
Battery Check	Battery check indicate good	
	batteries from 8Vdc to 13Vdc	
	during a load test of 205mA	
Battery OK	Battery OK Led from 8Vdc	
	and is operative while testing	
Power Source	1.5V(SUM-3) ×8. Type AA.	
Dimension	170(L)×165(W)×92(D)mm	
	(with housing front cover)	
Weight	1.1kg(battery included)	
Accessories	Test leads (AL-24A)	
	Fuse 0.5A 250V	
	Shoulder belt	
	Instruction manual	
	Batteries	



Test Leads Connections

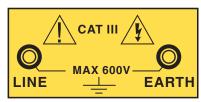

http://www.sew.com.tw e-mail: sales@sew.com.tw